

REPORT

GENERAL INFORMATION

Report Name

Bmw x5

Read out date

2025-03-05 12:08:04

Date of editing

2025-03-05 12:31:02

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	SUV
Make	Bmw
Model	X5
Engine capacity [ccm]	2997
Power [kW]	230
VIN	WBAKS610000N71005
Fuel Type	Diesel
Year of production	2017


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

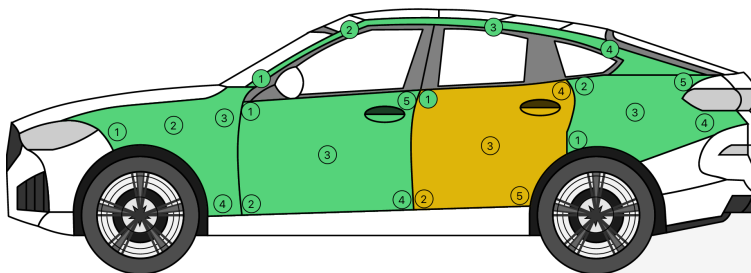


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Al	71	101	85	75	92	101	71	-	-	-
left front door	Fe	98	122	110	105	98	122	116	111	-	-
left rear door	Fe+Zn	165	227	188	165	227	205	179	166	-	-
left pillar	Fe+Zn	110	140	119	114	113	140	110	-	-	-
left rear fender/ bumper	Fe+Zn	103	138	119	128	122	103	138	105	-	-

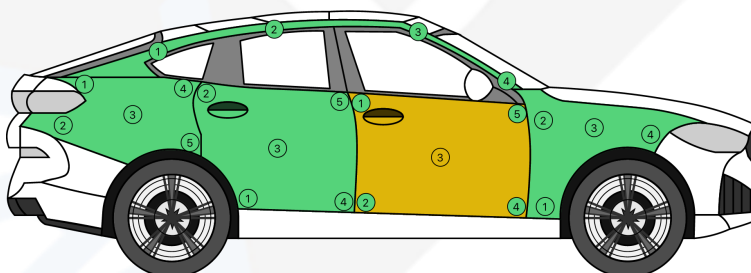

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Al	81	109	94	109	100	81	84	-	-	-
right front door	Fe+Zn	156	217	173	165	164	217	162	156	-	-
right rear door	Fe+Zn	78	138	112	78	92	120	138	133	-	-
right pillar	Fe+Zn	110	137	122	137	122	110	120	-	-	-
right rear fender/ bumper	Fe+Zn	99	145	117	99	114	102	125	145	-	-

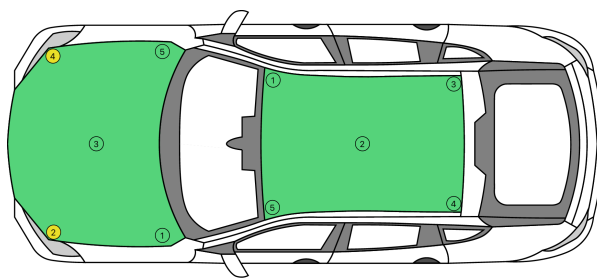


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Al	69	99	81	83	69	99	69	85	-	-
roof	Fe+Zn	119	146	131	141	119	125	146	125	-	-

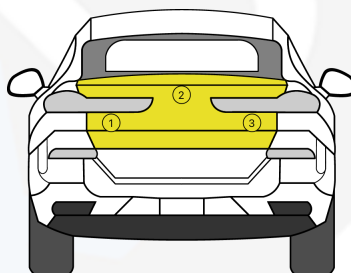

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	44	67	58	44	64	67	-	-	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

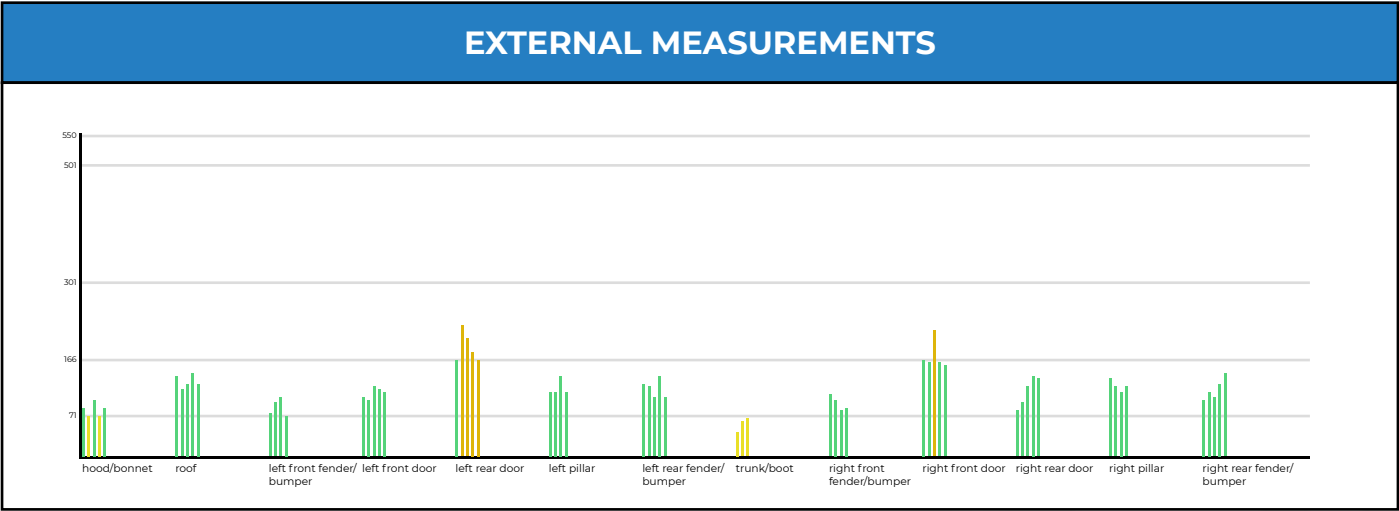

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 75	2. 92	3. 101	4. 71	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 84	3. 81	2. 100	1. 109	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	9	11	1	38										
left front door	1. 105	2. 98	3. 122	4. 116	5. 111	-	-	-	-	-	-	-	-	-
right front door	5. 156	4. 162	3. 217	2. 164	1. 165	-	-	-	-	-	-	-	-	-
DIFFERENCE	51	64	95	48	54									
left rear door	1. 165	2. 227	3. 205	4. 179	5. 166	-	-	-	-	-	-	-	-	-
right rear door	5. 133	4. 138	3. 120	2. 92	1. 78	-	-	-	-	-	-	-	-	-
DIFFERENCE	32	89	85	87	88									
left pillar	1. 114	2. 113	3. 140	4. 110	-	-	-	-	-	-	-	-	-	-
right pillar	4. 120	3. 110	2. 122	1. 137	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	6	3	18	27										
left rear fender/ bumper	1. 128	2. 122	3. 103	4. 138	5. 105	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	5. 145	4. 125	3. 102	2. 114	1. 99	-	-	-	-	-	-	-	-	-
DIFFERENCE	17	3	1	24	6									