

REPORT

GENERAL INFORMATION

Report Name

Honda jazz

Read out date

2025-04-14 10:42:18

Date of editing

2025-04-14 11:21:40

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	HATCHBACK 5D
Make	Honda
Model	Jazz
Engine capacity [ccm]	1339
Power [kW]	65
VIN	JHMGP1850DSK20063
Fuel Type	Hybrid
Year of production	2012


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

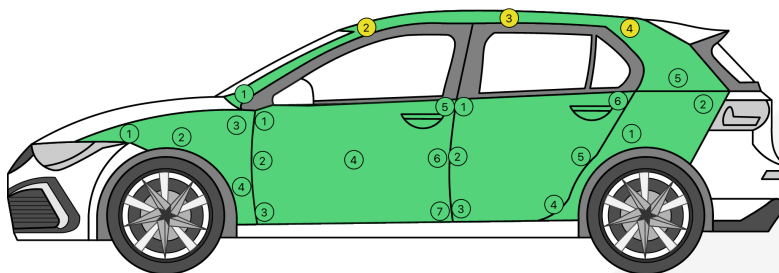


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe	85	106	94	106	93	92	85	-	-	-
left front door	Fe	78	135	103	109	86	95	114	101	135	78
left rear door	Fe	75	104	91	104	97	90	75	89	91	-
left pillar	Fe	50	137	81	137	64	50	52	104	-	-
left rear fender/ bumper	Fe	98	117	108	117	98	-	-	-	-	-

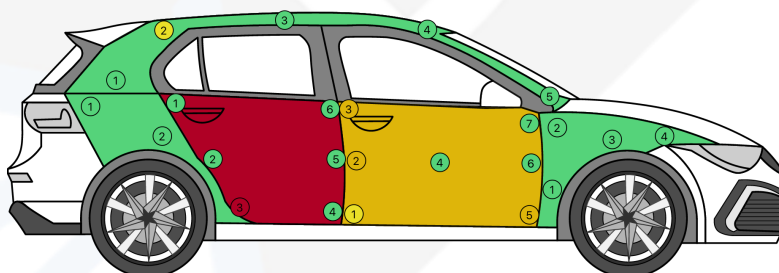

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe	119	144	134	119	141	130	144	-	-	-
right front door	Fe	39	195	149	39	179	195	144	193	135	156
right rear door	Fe+Zn	126	585	216	129	152	585	126	159	147	-
right pillar	Fe	52	95	79	92	52	81	95	76	-	-
right rear fender/ bumper	Fe+Zn	95	109	102	109	95	-	-	-	-	-

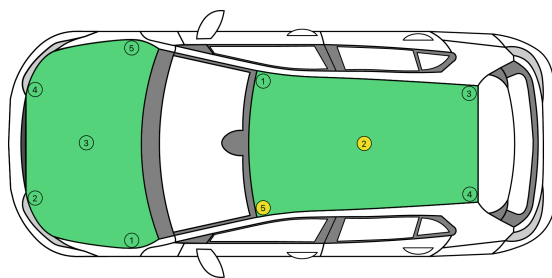


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe+Zn	102	129	117	126	102	117	109	129	-	-
roof	Fe	52	90	71	78	52	81	90	53	-	-

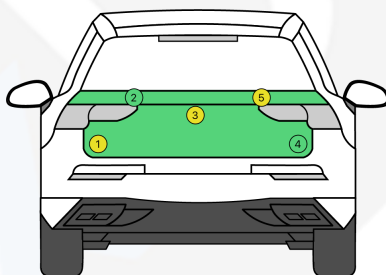

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe	62	88	72	62	88	69	80	63	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

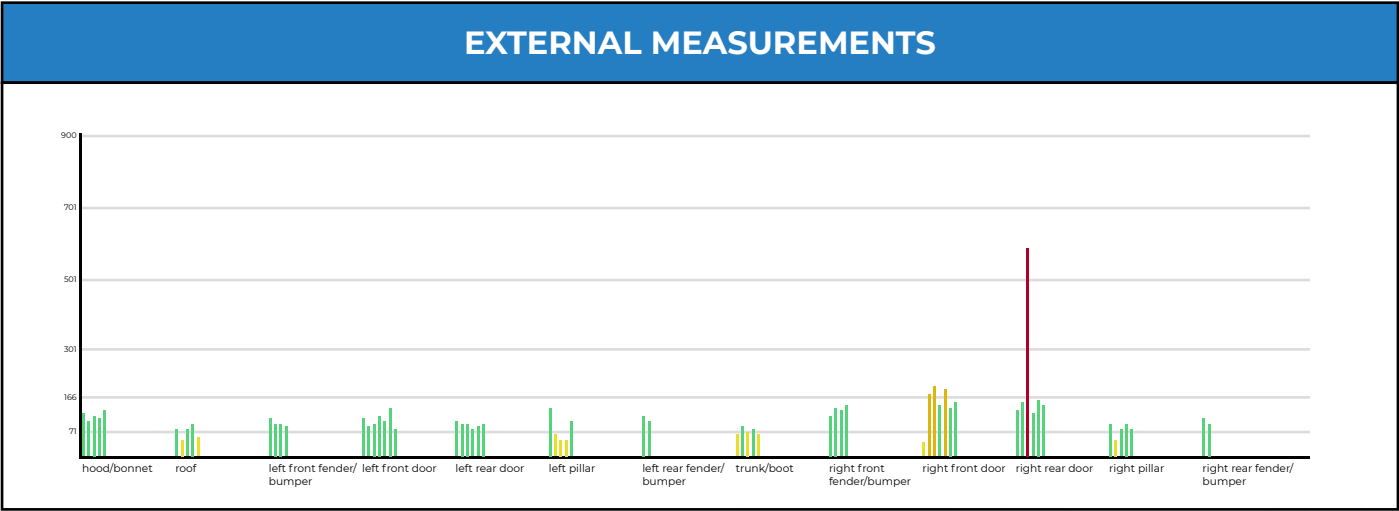

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 106	2. 93	3. 92	4. 85	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 144	3. 130	2. 141	1. 119	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	38	37	49	34										
left front door	1. 109	2. 86	3. 95	4. 114	5. 101	6. 135	7. 78	-	-	-	-	-	-	-
right front door	7. 156	6. 135	5. 193	4. 144	3. 195	2. 179	1. 39	-	-	-	-	-	-	-
DIFFERENCE	47	49	98	30	94	44	39							
left rear door	1. 104	2. 97	3. 90	4. 75	5. 89	6. 91	-	-	-	-	-	-	-	-
right rear door	6. 147	5. 159	4. 126	3. 585	2. 152	1. 129	-	-	-	-	-	-	-	-
DIFFERENCE	43	62	36	510	63	38								
left pillar	1. 137	2. 64	3. 50	4. 52	5. 104	-	-	-	-	-	-	-	-	-
right pillar	5. 76	4. 95	3. 81	2. 52	1. 92	-	-	-	-	-	-	-	-	-
DIFFERENCE	61	31	31	0	12									
left rear fender/ bumper	1. 117	2. 98	-	-	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	2. 95	1. 109	-	-	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	22	11												