

REPORT

GENERAL INFORMATION

Report Name

Passat b8

Read out date

2025-03-19 10:12:48

Date of editing

2025-03-19 11:52:51

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	ESTATE
Make	Wolksvagen
Model	Passat b8
Engine capacity [ccm]	1598
Power [kW]	88
VIN	WVWZZZ3CZGE069322
Fuel Type	Diesel
Year of production	2015


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

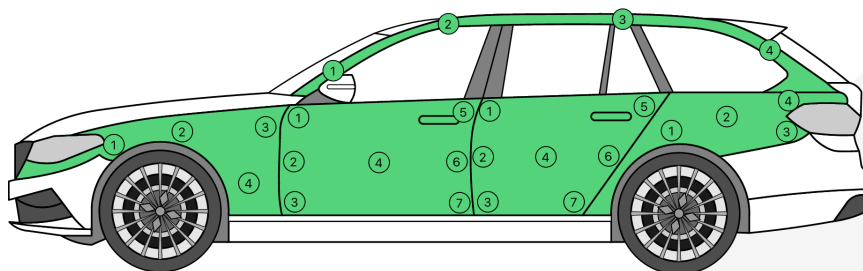


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe	99	123	111	123	112	111	99	-	-	-
left front door	Fe+Zn	92	153	108	97	108	103	153	106	98	92
left rear door	Fe+Zn	92	124	108	108	121	106	92	124	96	112
left pillar	Fe+Zn	107	155	129	137	155	107	118	-	-	-
left rear fender/ bumper	Fe+Zn	104	144	122	144	129	104	110	-	-	-

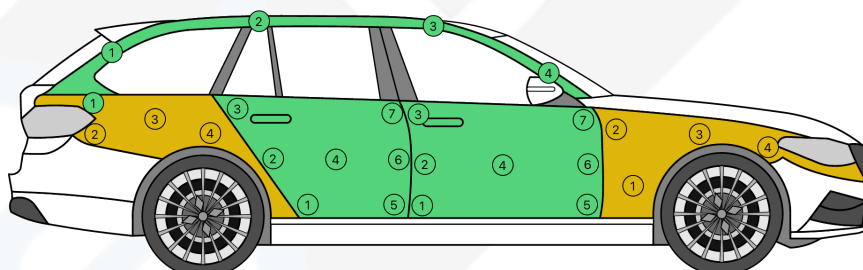

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe	172	199	185	186	172	182	199	-	-	-
right front door	Fe+Zn	72	126	101	126	105	99	72	125	96	82
right rear door	Fe	98	159	118	98	115	122	99	102	134	159
right pillar	Fe+Zn	113	147	126	125	113	118	147	-	-	-
right rear fender/ bumper	Fe+Zn	100	230	193	100	229	230	214	-	-	-

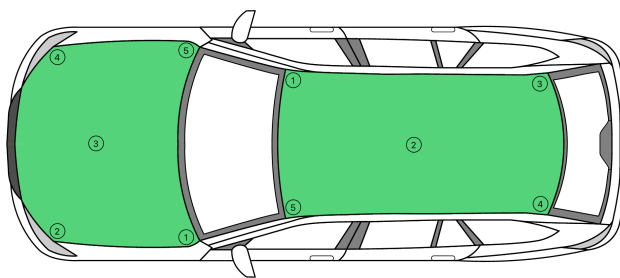


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe+Zn	80	123	105	99	117	123	80	106	-	-
roof	Fe+Zn	102	143	122	119	116	130	143	102	-	-

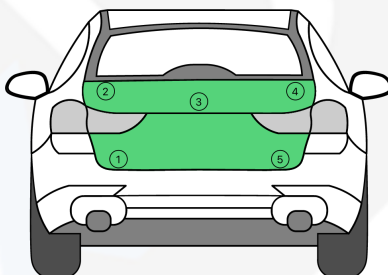

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	85	120	105	120	109	100	85	112	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

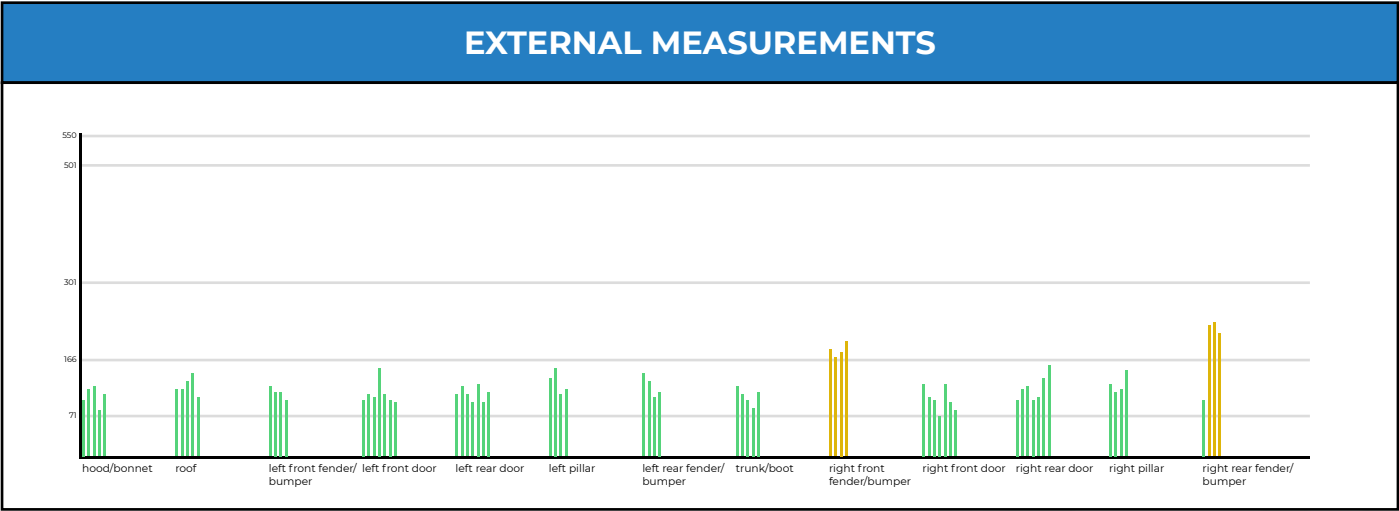

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 123	2. 112	3. 111	4. 99	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 199	3. 182	2. 172	1. 186	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	76	70	61	87										
left front door	1. 97	2. 108	3. 103	4. 153	5. 106	6. 98	7. 92	-	-	-	-	-	-	-
right front door	7. 82	6. 96	5. 125	4. 72	3. 99	2. 105	1. 126	-	-	-	-	-	-	-
DIFFERENCE	15	12	22	81	7	7	34							
left rear door	1. 108	2. 121	3. 106	4. 92	5. 124	6. 96	7. 112	-	-	-	-	-	-	-
right rear door	7. 159	6. 134	5. 102	4. 99	3. 122	2. 115	1. 98	-	-	-	-	-	-	-
DIFFERENCE	51	13	4	7	2	19	14							
left pillar	1. 137	2. 155	3. 107	4. 118	-	-	-	-	-	-	-	-	-	-
right pillar	4. 147	3. 118	2. 113	1. 125	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	10	37	6	7										
left rear fender/ bumper	1. 144	2. 129	3. 104	4. 110	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	4. 214	3. 230	2. 229	1. 100	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	70	101	125	10										