

REPORT

GENERAL INFORMATION

Report Name

Tesla

Read out date

2025-04-15 11:35:19

Date of editing

2025-04-15 11:49:56

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	SEDAN
Make	Tesla
Model	Model 3
Engine capacity [ccm]	-
Power [kW]	-
VIN	5YJ3E1EA7RF733070
Fuel Type	Electric
Year of production	2024


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

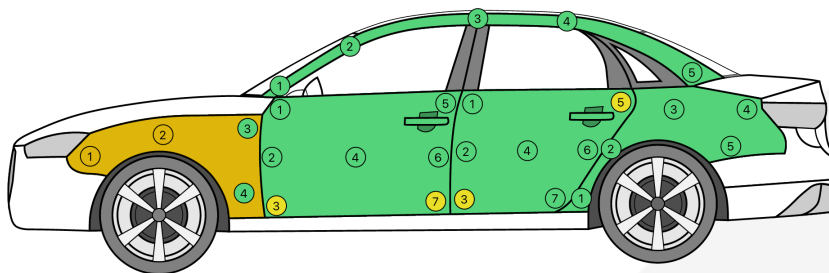

LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe+Zn	118	233	168	191	233	132	118	-	-	-
left front door	Al	59	119	87	97	101	59	119	82	82	68
left rear door	Al	27	111	83	107	107	56	111	27	87	85
left pillar	Fe+Zn	91	120	108	96	91	116	120	117	-	-
left rear fender/ bumper	Fe+Zn	79	132	110	105	106	132	79	130	-	-

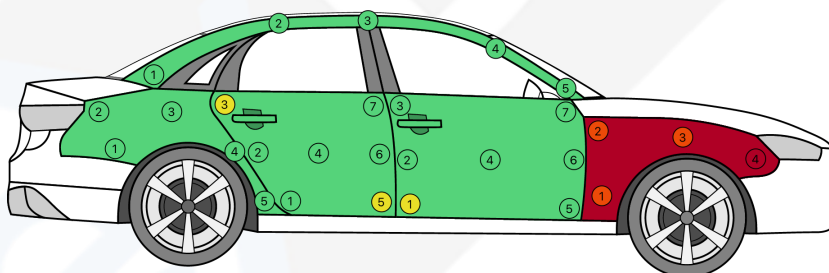


RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe+Zn	356	517	414	356	361	423	517	-	-	-
right front door	Al	50	106	89	50	100	72	106	93	102	100
right rear door	Al	36	133	84	85	77	36	133	55	115	87
right pillar	Fe+Zn	86	116	99	93	86	116	96	105	-	-
right rear fender/ bumper	Fe+Zn	95	102	98	97	102	95	95	100	-	-

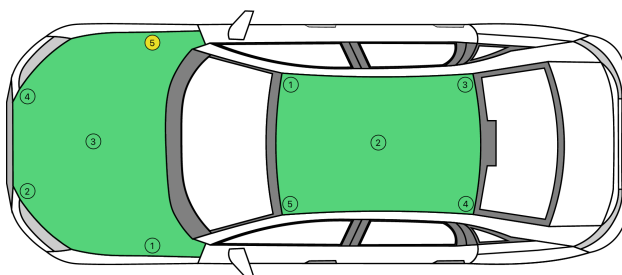

TOP

	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Al	54	115	85	71	93	115	92	54	-	-
roof	Fe+Zn	116	138	125	116	124	138	131	116	-	-

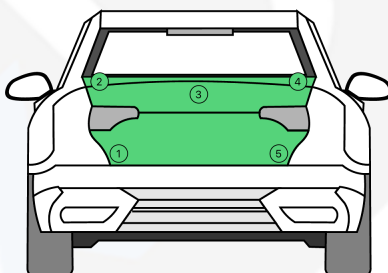


BACK

	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	85	144	109	96	111	144	111	85	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

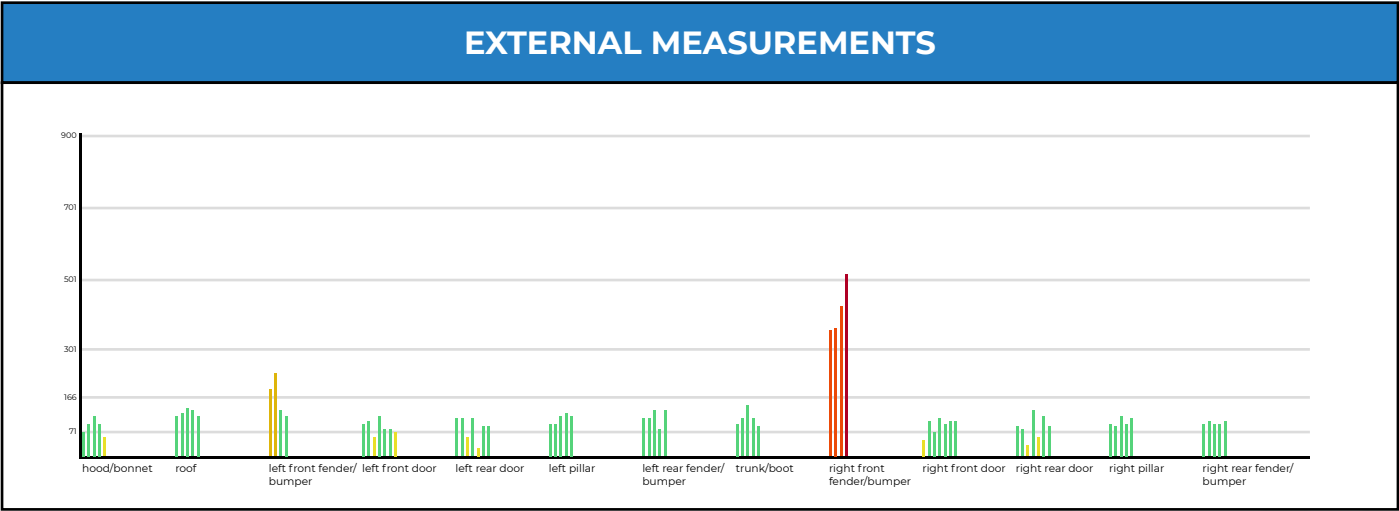

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 191	2. 233	3. 132	4. 118	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 517	3. 423	2. 361	1. 356	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	326	190	229	238										
left front door	1. 97	2. 101	3. 59	4. 119	5. 82	6. 82	7. 68	-	-	-	-	-	-	-
right front door	7. 100	6. 102	5. 93	4. 106	3. 72	2. 100	1. 50	-	-	-	-	-	-	-
DIFFERENCE	3	1	34	13	10	18	18							
left rear door	1. 107	2. 107	3. 56	4. 111	5. 27	6. 87	7. 85	-	-	-	-	-	-	-
right rear door	7. 87	6. 115	5. 55	4. 133	3. 36	2. 77	1. 85	-	-	-	-	-	-	-
DIFFERENCE	20	8	1	22	9	10	0							
left pillar	1. 96	2. 91	3. 116	4. 120	5. 117	-	-	-	-	-	-	-	-	-
right pillar	5. 105	4. 96	3. 116	2. 86	1. 93	-	-	-	-	-	-	-	-	-
DIFFERENCE	9	5	0	34	24									
left rear fender/ bumper	1. 105	2. 106	3. 132	4. 79	5. 130	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	5. 100	4. 95	3. 95	2. 102	1. 97	-	-	-	-	-	-	-	-	-
DIFFERENCE	5	11	37	23	33									