

REPORT

GENERAL INFORMATION

Report Name
Skoda superb

Read out date
2025-03-05 12:16:52

Date of editing
2025-03-05 12:45:57

Serial number
10373 PROFESSIONAL

Unit of measure
µm


VEHICLE DATA

Type	ESTATE
Make	Skoda
Model	Superb plug-in hybrid
Engine capacity [ccm]	1395
Power [kW]	160
VIN	TMBJW9NP8M7026730
Fuel Type	Hybrid
Year of production	-


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

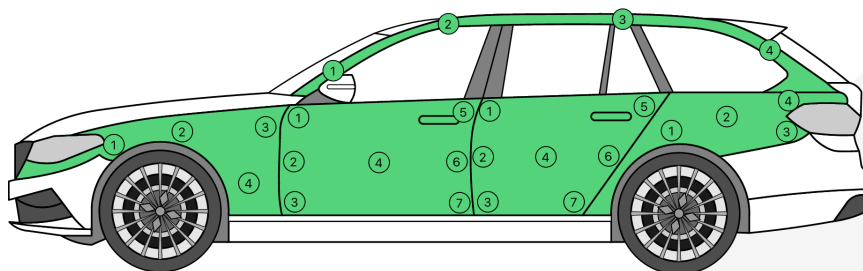


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/bumper	Fe+Zn	78	124	108	121	111	124	78	-	-	-
left front door	Fe	71	146	92	90	71	76	94	88	146	76
left rear door	Fe+Zn	72	114	98	100	106	77	102	114	114	72
left pillar	Fe	92	123	108	123	93	92	123	-	-	-
left rear fender/bumper	Fe+Zn	98	124	109	124	113	98	102	-	-	-

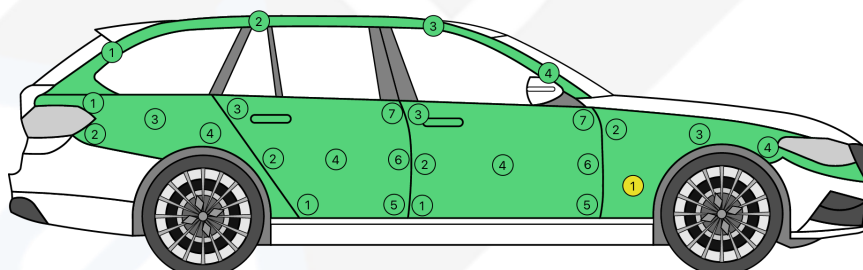

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/bumper	Fe+Zn	63	119	90	63	119	100	80	-	-	-
right front door	Fe+Zn	78	108	93	78	108	89	104	94	91	90
right rear door	Fe+Zn	71	110	94	72	110	104	99	71	105	98
right pillar	Fe	97	128	112	128	103	97	119	-	-	-
right rear fender/bumper	Fe+Zn	95	119	108	119	95	107	109	-	-	-

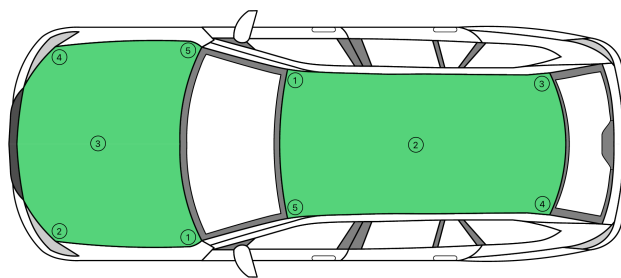


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe+Zn	100	114	105	100	104	114	102	106	-	-
roof	Fe+Zn	102	136	121	102	111	129	136	127	-	-

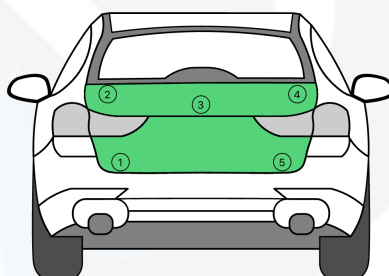

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	109	144	123	128	119	115	109	144	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

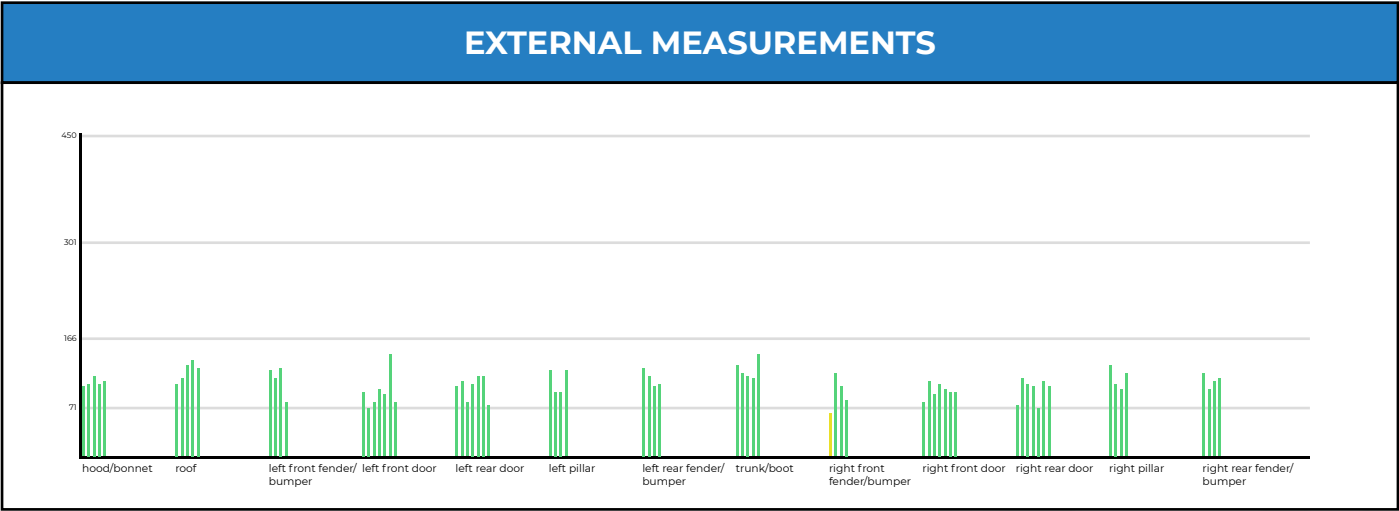

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 121	2. 111	3. 124	4. 78	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 80	3. 100	2. 119	1. 63	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	41	11	5	15										
left front door	1. 90	2. 71	3. 76	4. 94	5. 88	6. 146	7. 76	-	-	-	-	-	-	-
right front door	7. 90	6. 91	5. 94	4. 104	3. 89	2. 108	1. 78	-	-	-	-	-	-	-
DIFFERENCE	0	20	18	10	1	38	2							
left rear door	1. 100	2. 106	3. 77	4. 102	5. 114	6. 114	7. 72	-	-	-	-	-	-	-
right rear door	7. 98	6. 105	5. 71	4. 99	3. 104	2. 110	1. 72	-	-	-	-	-	-	-
DIFFERENCE	2	1	6	3	10	4	0							
left pillar	1. 123	2. 93	3. 92	4. 123	-	-	-	-	-	-	-	-	-	-
right pillar	4. 119	3. 97	2. 103	1. 128	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	4	4	11	5										
left rear fender/ bumper	1. 124	2. 113	3. 98	4. 102	-	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	4. 109	3. 107	2. 95	1. 119	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	15	6	3	17										